Memory Module Specifications



KF436C18RB2/32

32GB 4G x 64-Bit DDR4-3600 CL18 288-Pin DIMM



SPECIFICATIONS

17 cycles
45.75ns(min.)
350ns(min.)
32ns(min.)
32ns(min.) 94 V - 0

DESCRIPTION

Kingston FURY KF436C18RB2/32 is a 4G x 64-bit (32GB)
DDR4-3600 CL18 SDRAM (Synchronous DRAM) 2Rx8, memory
module, based on sixteen 2G x 8-bit FBGA components per module.
Each module kit supports Intel® Extreme Memory Profiles
(Intel® XMP) 2.0. Each module has been tested to run at
DDR4-3600 at a low latency timing of 18-22-22 at 1.35V. The
SPDs are programmed to JEDEC standard latency
DDR4-2400 timing of 17-17-17 at 1.2V. Each 288-pin DIMM
uses gold contact fingers. The JEDEC standard electrical
and mechanical specifications are as follows:

FEATURES

- Power Supply: VDD = 1.2V Typical
- VDDQ = 1.2V Typical
- VPP = 2.5V Typical
- VDDSPD = 2.2V to 3.6V
- On-Die termination (ODT)
- 16 internal banks; 4 groups of 4 banks each
- Bi-Directional Differential Data Strobe
- 8 bit pre-fetch
- Burst Length (BL) switch on-the-fly BL8 or BC4(Burst Chop)
- Height 1.65" (41.98mm), w/heatsink


FACTORY TIMING PARAMETERS

Default (JEDEC): DDR4-2400 CL17-17-17 @1.2V
 XMP Profile #1: DDR4-3600 CL18-22-22 @1.35V
 XMP Profile #2: DDR4-3000 CL16-18-18 @1.35V


Continued >>




MODULE WITH HEAT SPREADER

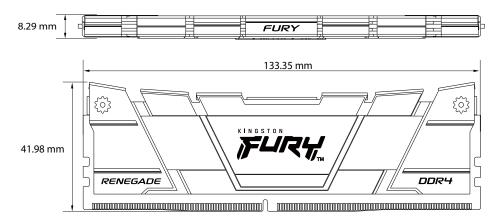

MODULE DIMENSIONS

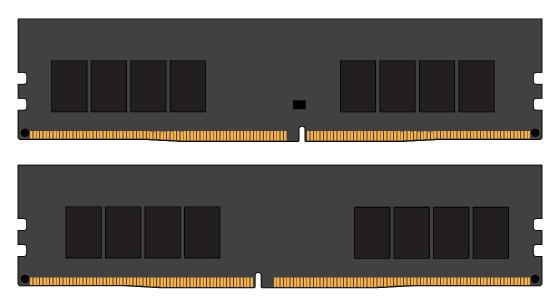

All measurements are in millimeters. (Tolerances on all dimensions are ±0.15 unless otherwise specified)

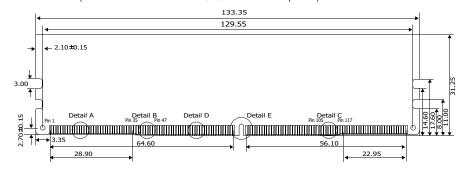

The product images shown are for illustration purposes only and may not be an exact representation of the product. Kingston reserves the right to change any information at anytime without notice.

FOR MORE INFORMATION, GO TO KINGSTON.COM

All Kingston products are tested to meet our published specifications. Some motherboards or system configurations may not operate at the published Kingston FURY memory speeds and timing settings. Kingston does not recommend that any user attempt to run their computers faster than the published speed. Overclocking or modifying your system timing may result in damage to computer components.